

Piper PA-32RT-300

Airworthiness Directive
Compliance Report

Date: 01/17/2020	Make/Model: Piper PA-32RT-300	Tail #: N3420M	Serial #: 32R-7885007
Airframe Hours: TACH: 2854.55 TTAF: 2854.55			
Misc:			
Engine: Lycoming IO-540-K1G5D	Serial #: L-1758-48A	Hours: TTE: 2854.55	SMOH:1090.55
Propeller: Hartzell HC-C3Y Series	Serial #: DY5658B	Hours: PSNEW: 962.55	TTP: 962.55

Piper PA-32RT-300

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
67-20-04 09/27/87 Airframe	Main Landing Gear Link		DNA By part number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
67-26-02 05/22/88 Airframe	Fuel Selector Valve		DNA by serial number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
78-18-08 05/25/79 Airframe	Engine Oil Cooler System	07/20/1979 TTAF: 176.28	SB 588B Service kit 763 859 installed	Yes	No further action required	Joel Newton 574306216A&P <i>Joel</i>
78-22-07 11/15/78 Airframe	Control Column Stop Sleeve	07/06/1979 TTAF: 173.0	SB 619 CW Mod kit 763 695V completed.		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
78-23-01 11/03/78 Airframe	Fuel Drain Lever Cover Door	03/20/2018 TTAF: 2854.2	SL 856 due 100hr Free movement. Door Kit 763-883 installed 04/06/2013 TTAF: 2621.35	Yes	100hrs DUE @ TTAF: 2954.2	Joel Newton 574306216A&P <i>Joel</i>
79-26-04 01/07/80 Airframe	Rudder Skin Cracks	02/20/2018 TTAF: 2854.2	25hr rudder skin bead cracks trailing edge visual inspection	Yes*	TTAF: 2879.2	Joel Newton 574306216A&P <i>Joel</i>
80-14-01 07/10/80 Airframe	Fuel Tank Vent Modification	01/02/1981 TTAF: 663.5	SB 646A kit installed P/N764-011V		No further action required	Joel Newton 574306216A&P <i>Joel</i>
80-14-03 07/01/80 Airframe	Radio Muting Relay Plug	09/28/2002 TTAF: 1797.8	SB 681 Complied with at radio installation 09/28/02		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
81-24-07 11/20/81 Airframe	Landing Gear Down Lock	05/01/1979 TTAF:168.0	SB 927 installed kit 766 253		No further action required	Joel Newton 574306216A&P <i>Joel</i>
86-17-01 08/21/86 Airframe	Ammeter Replacement	10/20/1986 TTAF: 949.03	Service Kit 765 186V installed		No further action required	Joel Newton 574306216A&P <i>Joel</i>
93-05-10 04/30/93 Airframe	Nose Landing Gear	06/24/1993 TTAF:1537.28	SB 955 Service kit 766 253 installed	Yes*	No further action required	Joel Newton 574306216A&P <i>Joel</i>
96-10-03 06/14/96 Airframe	Flap Handle Bolt	11/12/1996 TTAF: 1636.89	SB 965 New bushing installed AN23-11 bolt		TTAF: 3636.89	Joel Newton 574306216A&P <i>Joel</i>
99-05-09 03/19/99 Airframe	Induction Air Filter		SB 1022 DNA bracket air filter installed			Joel Newton 574306216A&P <i>Joel</i>
10-15-10 08/31/10 Airframe	Control Wheel Shafts	01/17/2020 TTAF: 2854.55	SB 1197C inspected found to be correct.		No further action needed	Joel Newton 574306216A&P <i>Joel</i>

13-02-13 03/11/13 Airframe	Stabilator Control System	TTAF: 2621.35 04/06/2013	SB 1245A 2000hrs DUE @ TTAF: 4621.35	Yes	TTAF: 4621.35	Joel Newton 574306216A&P <i>Joel</i>
17-14-04 08/15/17 Airframe	Oil Cooler Hose Assemblies	01/17/2020 TTAF: 2854.55	100 hr inspections	Yes*	TTAF: 2954.55	Joel Newton 574306216A&P <i>Joel</i>


Engine: Lycoming IO-540-K1G5D

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
63-14-03 07/06/03 Engine	Oil Pump Drive Shaft	05/15/2002 TTAF:1765.0	DNA by serial number	Yes*	No further action needed	Joel Newton 574306216A&P <i>Joel</i>
66-20-04 08/27/66 Engine	Oil Filter Adapter Gasket	05/15/2002 TTAF:1765.0	SB 307 gasket P/N 76691 installed		adaptor gasket change	Joel Newton 574306216A&P <i>Joel</i>
75-08-09 08/16/77 Engine	Oil Pump Drive Shaft and Impeller	05/15-2002 TTAF: 1765.0	SI 385C DNA by model or serial number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
75-09-15 04/30/75 Engine	Bendix Fuel Injector Flow Divider Cover Gasket	05/15-2002 TTAF: 1765.0	SB 362 DNA by part number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
78-23-10 11/07/78 Engine	Bendix RSA Series Fuel Injector Bellows Seal	05/15-2002 TTAF: 1765.0	SB 430 DNA by part number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
79-04-05 09/26/79 Engine	Bendix RSA Series Fuel Injectors Diaphragm	05/15-2002 TTAF: 1765.0	SB 433A DNA by model number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
83-22-04 11/04/83 Engine	Bendix Fuel Injector Fuel Diaphragm Stem	10/05/1992 TTAF: 1518.96	SB 467 overhauled & tested		No further action required	Joel Newton 574306216A&P <i>Joel</i>
92-12-05 07/10/92 Engine	Piston Pin Failure	05/15-2002 TTAF: 1765.0	SB 501 B DNA serial number not listed in SB		No further action required	Joel Newton 574306216A&P <i>Joel</i>
93-11-11 06/21/93 Engine	Diaphragm Fuel Pumps Overhauled (by AAI)	05/15-2002 TTAF: 1765.0	MSB 002 DNA by model number		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
95-07-01 04/12/95 Engine	Superior Air Parts Connecting Rod Bolts	05/15-2002 TTAF: 1765.0	SB 05-002 DNA Superior parts not used		No further action required	Joel Newton 574306216A&P <i>Joel</i>
95-26-02 01/24/96 Engine	Detonation Due To Low Octane	01/17/2020 TTAF: 2854.55	SB 1191 DNA Aircraft not listed		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
96-09-10 07/15/96 Engine	Oil Pump Impeller Failure	05/15-2002 TTAF: 1765.0	SB 455D addressed at overhaul		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
96-23-03 12/17/96 Engine	High Pressure Fuel Pumps	05/15-2002 TTAF: 1765.0	SB 525A Overhauled 06/15/02		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
97-15-11 08/12/97 Engine	Piston Pin Failure	05/15-2002 TTAF: 1765.0	MSB 527C New installed 05/15/02		No further action needed	Joel Newton 574306216A&P <i>Joel</i>
98-17-11 10/19/98 Engine	Crankshafts Installed by Nelson Balancing Service	05/15-2002 TTAF: 1765.0	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel</i>


02-12-07 07/03/02 Engine	Oil Filter Converter Plate Gasket or Plate Kit	05/15-2002 TTAF: 1765.0	MSB 543A DNA by time table	Yes*	No further action needed	Joel Newton 574306216A&P <i>me</i>
02-19-03 09/20/02 Engine	Crankshaft Failure	01/17/2020 TTAF: 2854.55	MSB 552 STC not installed		No further action required	Joel Newton 574306216A&P <i>me</i>
03-14-03 08/14/03 Engine	Rotary Fuel Pump Leaks	01/17/2020 TTAF: 2854.55	SB 529B Not installed	Yes*	No further action required	Joel Newton 574306216A&P <i>me</i>
04-05-24 03/30/04 Engine	Crankshaft Gear Retaining Bolts	05/15-2002 TTAF: 1765.0	SB 554 DNA not listed in SB new bolt installed 05/15/02		No further action needed	Joel Newton 574306216A&P <i>me</i>
04-10-14 06/25/04 Engine	Crankshaft Gear Retaining Bolt	05/15-2002 TTAF: 1765.0	SB 475C at new bolt installed overhaul		sudden stoppage or prop strike	Joel Newton 574306216A&P <i>me</i>
05-19-11 10/21/05 Engine	Crankshaft Failures	05/15/2005 TTAF: 2207	SB 566		No further action needed	Joel Newton 574306216A&P <i>me</i>
09-02-03 02/09/09 Engine	RSA-5 or RSA-10 Series - Fuel Injection Servo Plug Gasket	01/17/2020 TTAF: 2854.55	SB PRS-107 4 Checked plug and gasket for security torque 90-100 in- lbs	Yes*	TTAF:2904.55 or oil change	Joel Newton 574306216A&P <i>me</i>
12-03-06 02/24/12 Engine	AVStar Fuel Servo Diaphragm	01/17/2020 TTAF: 2854.55	MSB AFS-SB62 DNA by kit number		No further action needed	Joel Newton 574306216A&P <i>me</i>
12-19-01 10/24/12 Engine	Crankshaft Replacement	05/15-2002 TTAF: 1765.0	MSB 569A Not listed in table 2 or 5		No further action required	Joel Newton 574306216A&P <i>me</i>
15-19-07 11/03/15 Engine	Fuel Injector Fuel Lines and Clamps	01/17/2020 TTAF: 2854.55	SB342G, Supp 1, Supp 2 Clamps and lines checked visually and security of clamps checked	Yes	when cowl is removed	Joel Newton 574306216A&P <i>me</i>
17-16-11 08/15/17 Engine	Connecting Rod Failure	01/17/2020 TTAF: 2854.55	MSB 632B Rods not listed in SB		No further action required	Joel Newton 574306216A&P <i>me</i>

Propeller: Hartzell HC-C3Y Series


AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
94-17-13 Propeller	09/15/94	Propeller Hub Grease Fitting Hole Cracks	04/30/2003 TTAF: 1892.0	SB165E Prop not listed in SB new 04/03	Yes	No further action needed	Joel Newton 574306216A&P <i>me</i>
01-07-03 Propeller	06/04/01	BASCO Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>me</i>
03-13-17 Propeller	07/18/03	T and W Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>me</i>
05-14-11 Propeller	08/17/05	Southern California Propeller Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>me</i>
06-24-07 Propeller	01/03/07	Oxford Aviation/CSE Aviation Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>me</i>
07-26-09 Propeller	01/30/08	Fatigue Cracks	04/30/03 TTAF: 1892.0	SB 118A New propeller SB complied with at mfg		No further action needed	Joel Newton 574306216A&P <i>me</i>

08-13-28 07/17/08 Propeller	Hub Blade Socket Lubrication Hole Cracks	01/17/2020 TTAF: 2854.55	50HRS/ 12 MONTHW ASB HC- ASB-61-297 R1 No cracks found. Visual check	Yes*	01/21 TTAF: 2904.55	Joel Newton 574306216A&P 
-----------------------------------	---	-----------------------------	--	------	---------------------	--

Appliance: Power Plant - Fuel Systems - Injectors

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
09-02-03 02/09/09 Appliance	RSA-5 or RSA-10 Series - Fuel Injection Servo Plug Gasket	01/17/2020 TTAF: 2854.55	MSB PRS-107 4 checked for leaks and security of nut, torque 100 in lbs	Yes*	every oil change or 50hrs run time due TTAF: 2904.55	Joel Newton 574306216A&P 

Appliance: Power Plant - Ignition - Switches

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
76-07-12 08/30/77 Appliance	10-357XXX, 10-126XXX, 10- 157XXX - Switch Repair or Replacement	01/17/2020 TTAF: 2854.55	SB 583 operation check satisfactory	Yes	TTAF: 2954.55	Joel Newton 574306216A&P 

Date: 01/17/2020	Make/Model: Piper PA-32RT-300	Tail #: N3420M	Serial #: 32R-7885007
Airframe Hours: TACH: 2854.55 TTAF: 2854.55			
Misc:			
Engine: Lycoming IO-540-K1G5D	Serial #: L-1758-48A	Hours: TTE: 2854.55	SMOH: 1090.55
Propeller: Hartzell HC-C3Y Series	Serial #: DY5658B	Hours: PSNEW: 962.55	TTP: 962.55

Piper PA-32RT-300

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
67-20-04 09/27/67 Airframe	Main Landing Gear Link		DNA By part number		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
67-25-02 05/22/68 Airframe	Fuel Selector Valve		DNA by serial number		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
78-16-08 06/25/79 Airframe	Engine Oil Cooler System	07/20/1979 TTAF: 178.26	SB 566B Service kit 763 856 installed	Yes	No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
78-22-07 11/15/78 Airframe	Control Column Stop Sleeve	07/09/1979 TTAF: 173.0	SB 619 CW Mod kit 763 895V		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
78-23-01 11/03/78 Airframe	Fuel Drain Lever Cover Door	03/20/2018 TTAF: 2854.2	SL 856 dual 100hr Free movement. Door Kit 763-883 installed 04/06/2013 TTAF: 2621.35	Yes	100hrs DUE @ TTAF: 2954.2	Joel Newton 574306216A&P <i>Joel Newton</i>
79-26-04 01/07/80 Airframe	Rudder Skin Cracks	02/20/2018 TTAF: 2854.2	25hr rudder skin bead cracks trailing edge visual inspection	Yes*	TTAF: 2879.2	Joel Newton 574306216A&P <i>Joel Newton</i>
80-14-01 07/10/80 Airframe	Fuel Tank Vent Modification	01/02/1981 TTAF: 653.5	SB 848A kit installed P/N784-011V		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
80-14-03 07/01/80 Airframe	Radio Muting Relay Plug	09/28/2002 TTAF: 1797.8	SB 661 Complied with at radio installation 09/28/02		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
81-24-07 11/20/81 Airframe	Landing Gear Down Lock	05/01/1979 TTAF:166.0	SB 927 installed kit 766 253		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
86-17-01 08/21/86 Airframe	Ammeter Replacement	10/20/1986 TTAF: 949.03	Service Kit 765 186V installed		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
93-05-10 04/30/93 Airframe	Nose Landing Gear	06/24/1993 TTAF:1537.28	SB 955 Service kit 766 253 installed	Yes*	No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
96-10-03 06/14/96 Airframe	Flap Handle Bolt	11/12/1996 TTAF: 1636.89	SB 965 New bushing installed AN23-11 bolt		TTAF: 3636.89	Joel Newton 574306216A&P <i>Joel Newton</i>
99-05-09 03/19/99 Airframe	Induction Air Filter		SB 1022 DNA bracket air filter installed			Joel Newton 574306216A&P <i>Joel Newton</i>
10-15-10 08/31/10 Airframe	Control Wheel Shafts	01/17/2020 TTAF: 2854.55	SB 1197C inspected found to be correct.		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>

13-02-13 03/11/13 Airframe	Stabilator Control System	TTAF: 2621.35 04/06/2013	SB 1245A 2000hrs DUE @ TTAF: 4621.35	Yes	TTAF: 4621.35	Joel Newton 574306216A&P <i>Joel N</i>
17-14-04 08/15/17 Airframe	Oil Cooler Hose Assemblies	01/17/2020 TTAF: 2854.55	100 hr inspections	Yes*	TTAF: 2954.55	Joel Newton 574306216A&P <i>Joel N</i>

Engine: Lycoming IO-540-K1G5D

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
63-14-03 07/06/63 Engine	Oil Pump Drive Shaft	05/15/2002 TTAF:1765.0	DNA by serial number	Yes*	No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
66-20-04 08/27/66 Engine	Oil Filter Adapter Gasket	05/15/2002 TTAF:1765.0	SB 307 gasket P/N 76691 installed		adapter gasket change.	Joel Newton 574306216A&P <i>Joel N</i>
75-08-08 08/18/77 Engine	Oil Pump Drive Shaft and Impeller	05/15-2002 TTAF: 1765.0	SI 385C DNA by model or serial number		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
75-09-15 04/30/75 Engine	Bendix Fuel Injector Flow Divider Cover Gasket	05/15-2002 TTAF: 1765.0	SB 382 DNA by part number		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
78-23-10 11/07/78 Engine	Bendix RSA Series Fuel Injector Bellows Seal	05/15-2002 TTAF: 1765.0	SB 430 DNA by part number.		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
79-04-05 09/26/79 Engine	Bendix RSA Series Fuel Injectors Diaphragm	05/15-2002 TTAF: 1765.0	SB 433A DNA by model number		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
83-22-04 11/04/83 Engine	Bendix Fuel Injector Fuel Diaphragm Stem	10/05/1992 TTAF: 1515.96	SB 467 overhauled & tested		No further action required	Joel Newton 574306216A&P <i>Joel N</i>
92-12-05 07/10/92 Engine	Piston Pin Failure	05/15-2002 TTAF: 1765.0	SB 501 B DNA serial number not listed in SB		No further action required	Joel Newton 574306216A&P <i>Joel N</i>
93-11-11 06/21/93 Engine	Diaphragm Fuel Pumps Overhauled (by AAI)	05/15-2002 TTAF: 1765.0	MSB 002 DNA by model number		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
95-07-01 04/12/95 Engine	Superior Air Parts Connecting Rod Bolts	05/15-2002 TTAF: 1765.0	SB 05-002 DNA Superior parts not used		No further action required	Joel Newton 574306216A&P <i>Joel N</i>
95-26-02 01/24/96 Engine	Detonation Due To Low Octane	01/17/2020 TTAF: 2854.55	SB 1191 DNA Aircraft not listed		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
96-09-10 07/15/96 Engine	Oil Pump Impeller Failure	05/15-2002 TTAF: 1765.0	SB 455D addressed at overhaul		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
96-23-03 12/17/96 Engine	High Pressure Fuel Pumps	05/15-2002 TTAF: 1765.0	SB 525A Overhauled 05/15/02		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
97-15-11 08/12/97 Engine	Piston Pin Failure	05/15-2002 TTAF: 1765.0	MSB 527C New installed 05/15/02		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>
98-17-11 10/19/98 Engine	Crankshafts Installed by Nelson Balancing Service	05/15-2002 TTAF: 1765.0	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel N</i>

02-12-07 07/03/02 Engine	Oil Filter Converter Plate Gasket or Plate Kit	05/15-2002 TTAF: 1785.0	MSB 543A DNA by time table	Yes*	No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
02-19-03 09/20/02 Engine	Crankshaft Failure	01/17/2020 TTAF: 2854.55	MSB 552 STC not installed		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
03-14-03 08/14/03 Engine	Rotary Fuel Pump Leaks	01/17/2020 TTAF: 2854.55	SB 529B Not installed	Yes*	No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
04-05-24 03/30/04 Engine	Crankshaft Gear Retaining Bolts	05/15-2002 TTAF: 1785.0	SB 554 DNA not listed in SB new bolt installed 05/15/02		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
04-10-14 06/25/04 Engine	Crankshaft Gear Retaining Bolt	05/15-2002 TTAF: 1785.0	SB 475C at new bolt installed overhaul		sudden stoppage or prop strike	Joel Newton 574306216A&P <i>Joel Newton</i>
05-19-11 10/21/05 Engine	Crankshaft Failures	05/15/2006 TTAF: 2207	SB 566		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
09-02-03 02/09/09 Engine	RSA-5 or RSA-10 Series - Fuel Injection Servo Plug Gasket	01/17/2020 TTAF: 2854.55	SB PR5-107 4 Checked plug and gasket for security torque 90-100 in-lbs	Yes*	TTAF: 2904.55 or oil change	Joel Newton 574306216A&P <i>Joel Newton</i>
12-03-08 02/24/12 Engine	AVStar Fuel Servo Diaphragm	01/17/2020 TTAF: 2854.55	MSB AFS-SB62 DNA by kit number		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
12-19-01 10/24/12 Engine	Crankshaft Replacement	05/15-2002 TTAF: 1785.0	MSB 589A Not listed in table 2 or 5		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>
15-19-07 11/03/15 Engine	Fuel Injector Fuel Lines and Clamps	01/17/2020 TTAF: 2854.55	SB342G, Supp 1, Supp 2 Clamps and lines checked visually and security of clamps checked	Yes	when cowf is removed	Joel Newton 574306216A&P <i>Joel Newton</i>
17-16-11 08/15/17 Engine	Connecting Rod Failure	01/17/2020 TTAF: 2854.55	MSB 632B Rods not listed in SB		No further action required	Joel Newton 574306216A&P <i>Joel Newton</i>

Propeller: Hartzell HC-C3Y Series

AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
94-17-13 Propeller	09/15/94	Propeller Hub Grease Fitting Hole Cracks	04/30/2003 TTAF: 1892.0	SB185E Prop not listed in SB new 04/03	Yes	No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
01-07-03 Propeller	06/04/01	BASCO Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
03-13-17 Propeller	07/18/03	T and W Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
05-14-11 Propeller	08/17/05	Southern California Propeller Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
06-24-07 Propeller	01/03/07	Oxford Aviation/CSE Aviation Serviced Propellers	01/17/2020 TTAF: 2854.55	Service not used		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>
07-26-09 Propeller	01/30/08	Fatigue Cracks	04/30/03 TTAF: 1892.0	SB 118A New propeller SB complied with at mig		No further action needed	Joel Newton 574306216A&P <i>Joel Newton</i>

08-13-28 07/17/08 Propeller	Hub Blade Socket Lubrication Hole Cracks	01/17/2020 TTAF: 2854.55	50HRS/ 12 MONTHW ASB HC- ASB-81-297 R1 No cracks found. Visual check	Yes*	01/21 TTAF: 2904.55	Joel Newton 574306216A&P <i>Joel Newton</i>
-----------------------------------	---	-----------------------------	--	------	---------------------	---

Appliance: Power Plant - Fuel Systems - Injectors

AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
09-02-03 Appliance	02/09/09	RSA-5 or RSA-10 Series - Fuel Injection Servo Plug Gasket	01/17/2020 TTAF: 2854.55	MSB PRS-107 4 checked for leaks and security of nut, torque 100 in lbs	Yes*	every oil change or 50hrs run time due TTAF: 2904.55	Joel Newton 574306216A&P <i>Joel Newton</i>

Appliance: Power Plant - Ignition - Switches

AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
76-07-12 Appliance	08/30/77	10-357XXX, 10-126XXX, 10- 157XXX - Switch Repair or Replacement	01/17/2020 TTAF: 2854.55	SB 583 operation check satisfactory	Yes	TTAF: 2954.55	Joel Newton 574306216A&P <i>Joel Newton</i>