

Date: 10/27/2023	Make/Model: Piper PA-28R-200	Tail #: N33075	Serial #: 28R-7535116
Airframe Hours: 9625.2 TTA			
Misc: Hobs 6093.7 Tach 7529.0			
Engine: Lycoming IO-360-C1C	Serial #: L-7592-51A	Hours: 1985.2 SMOH, 6624.1 TTE	
Propeller: Hartzell HC-C3Y Series	Serial #: DY3385A	Hours: 1402.8	

Piper PA-28R-200

AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
62-19-03 Airframe	08/28/62	Propeller Attachment Bolts		DNA by s/n affected s/n are: Applies to All Model PA-28 Aircraft, Serial Numbers 28-1 to 28-314 Inclusive, 28-317 to 28-326 Inclusive, 28-328 to 28-331 Inclusive, 28-333 to 28-341 Inclusive, 28-343, 28-345 to 28-348 Inclusive, 28-351, 28-352, 28-356, 28-359, and 28-365.		n/a	Rueben A Walkup A&P33689611A
64-06-06 Airframe	04/06/64	Control Wheel Assembly		DNA affected p/n not installed	Yes	n/a	Rueben A Walkup A&P33689611A
67-20-04 Airframe	09/27/67	Main Landing Gear Link		DNA part not installed.		n/a	Rueben A Walkup A&P33689611A
67-26-02 Airframe	05/22/68	Fuel Selector Valve		DNA by model affected models are On Model PA-28-235 airplanes Serial Numbers 28-10001 through 28-10985; Model PA-32-260 airplanes, Serial Numbers 32-04, 32-1 through 32-14 and 32-16 through 32-853; Models PA 32-300 and PA 32S-300 airplanes, Serial Numbers 32-15 and 32-40000 through 32-40265.		n/a	Rueben A Walkup A&P33689611A
69-12-01 Airframe	06/10/69	Air Induction Hose		DNA by s/n affected numbers are PA-28R-180 series airplanes, Serial Numbers 28-30004 through 28-31092 and to PA-28R-200 series airplanes, Serial Numbers 28-35000 through 28-35237, 28-35239 through 28-35251 and 38-35253 through 28-35256.	Yes*	n/a	Rueben A Walkup A&P33689611A
69-15-01 Airframe	07/21/69	Control Wheel Retaining Pin		DNA by s/n affected # are PA-28R-200, Serial Nos. 28-35001 through 28-35265		n/a	Rueben A Walkup A&P33689611A
70-09-02 Airframe	01/20/72	Propeller Spinner		DNA by m/n affected # are PA-28R-180 airplanes serial numbers 28R-31071 and 28R-31073 through 28R-31266, and PA-28R-200 airplanes serial numbers 28R-35001 through 28R-35698, 28R-35700, 28R-35702, 28R-35704, 28R-35705, 28R-35709, and 28R-35711 through 28R-35713.	Yes*	n/a	Rueben A Walkup A&P33689611A
70-26-04 Airframe	06/24/71	Stabilizer Balance Weight Tube		DNA by s/n affected # are PA-28R-200, Serial Numbers 28R-30482, 28R-35001 through 28R-35820, and 28R-7135001 through 28R-7135104.	Yes	n/a	Rueben A Walkup A&P33689611A

71-21-08 10/13/71 Airframe	Fuel Selector Handle		DNA by s/n affected # are PA-28R-200 airplanes Serial Numbers 28R-7135001 through 28R-7135254		n/a	Rueben A Walkup A&P33689611A
72-14-07 07/07/72 Airframe	Stabilator Hinge Attachment Fittings		DNA by s/n affected # are PA-28R-200 Serial Nos. 28R-35001 thru 28R-7235217		n/a	Rueben A Walkup A&P33689611A
72-17-05 08/15/72 Airframe	Electric Trim Switch		DNA by s/n affected # are, Serial Nos. 28R-35001 to 28R-35820 inclusive, 28R-7135001 to 28R-7135102		n/a	Rueben A Walkup A&P33689611A
74-09-04 04/24/74 Airframe	Rear Seat Belt Installation		DNA by s/n affected # are Model PA-28R-200 Serial Numbers 28R-7235001 through 28R-7335446		n/a	Rueben A Walkup A&P33689611A
75-08-03 04/04/75 Airframe	Fuel Drain Valves	10/23/2023 at 7528.3	Visually confirmed PCW		na	Alex VanderMey 3757160
75-24-02 11/21/75 Airframe	Quick-Disconnect Seats Rear Legs Inspection		DNA by s/n affected # are PA-28R-200 serial numbers 28R-7135001 through 28R-7535041	Yes	n/a	Rueben A Walkup A&P33689611A
76-15-08 09/24/76 Airframe	Nose Gear Trunnion		DNA by s/n affected # are PA-28R-200 serial numbers 28R-7635001 to 28R-7635432		n/a	Rueben A Walkup A&P33689611A
77-01-01 01/07/77 Airframe	Erroneous Fuel Quantity Gauge		PCW placard installed		n/a	Rueben A Walkup A&P33689611A
77-23-03 11/14/77 Airframe	Engine Control Rod End Bearings		PCW silver ball retainer installed		n/a	Rueben A Walkup A&P33689611A
80-19-01 09/12/80 Airframe	Carbon Monoxide in Cabin	11/10/1980 tach 1347	PCW by instructions in SB 691A		n/a	Rueben A Walkup A&P33689611A
81-11-02 R1 10/02/81 Airframe	Oil Drain Valves	8/17/82 @ 1899.0 tach	PCW placard installed		na	Rueben A Walkup A&P33689611A
82-06-11 R1 06/16/82 Airframe	Nose Landing Gear		DNA by s/n affected # are PA-28R-200 Arrow II 28R-7635522 through 28R-7635545		na	Rueben A Walkup A&P33689611A
86-17-01 08/21/86 Airframe	Ammeter Replacement	1/26/01 3681.0 tach	PCW by ammeter replacement		na	Rueben A Walkup A&P33689611A
87-08-08 R3 05/22/89 Airframe	Rescission of 87-08-08 and Subsequent Revisions		rescinded		na	Rueben A Walkup A&P33689611A
94-14-14 08/19/94 Airframe	Nose Landing Gear Modification	10/26/94 2535.0 tach	PCW by SK 704-377		n/a	Rueben A Walkup A&P33689611A
96-10-03 06/14/96 Airframe	Flap Handle Bolt	7/05 tach 2779.5	PCW by SB 965		na	Rueben A Walkup A&P33689611A
97-01-01 R1 12/08/98 Airframe	Main Gear Sidebrace Stud	7/1/96 @ 2779.5	PCW (iv) No repetitive inspections will be required by this AD when a P/N 78717-02 has been installed.	Yes*	na	Rueben A Walkup A&P33689611A
10-15-10 08/31/10 Airframe	Control Wheel Shafts	10/04/10 @ 6995 hrs	PCW by SB 1197B		na	Rueben A Walkup A&P33689611A

13-02-13 03/11/13 Airframe	Stabilator Control System	10/23/2023 at 7528.3	CW By visual inspection of stabilator control cable system	Yes	2,000 hours time-in-service or 7 years	Alex VanderMey 3757160 <i>Alex VanderMey</i>
17-14-04 08/15/17 Airframe	Oil Cooler Hose Assemblies	01/03/19 @7454 hrs	PCW technical standard order C53a (TSO-C53a), Type D requirements. Installed. No further action required	Yes*	na	Rueben A Walkup A&P33689611A
18-07-03 04/20/18 Airframe	Fuel Tank Selector Cover Placards	6/13/19 @5454.3	PCW with SB 1309A placards correct		na	Rueben A Walkup A&P33689611A
20-26-16 02/16/21 Airframe	Wing Separation by Main Spar Cap Fatigue Cracking	5/16/2022 @ 7528.3	By eddy current inspection	Yes	na	Rueben A Walkup A&P33689611A

Engine: Lycoming IO-360-C1C

AD# Category	Eff Date	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
66-20-04 Engine	08/27/66	Oil Filter Adapter Gasket		DNA by s/n affected # are O-360 Series, Engine Serial Number 9346-36A and Higher.		N/A	Rueben A Walkup A&P33689611A
71-05-02 Engine	02/13/73	Crankcase Main Bearings		PCW at overhaul.	Yes*	n/a	Rueben A Walkup A&P33689611A
71-11-02 Engine	03/14/72	Intake and Exhaust Hydraulic Tappet Plunger Assembly	11/22/06 at 4638.9	PCW at overhaul			Rueben A Walkup A&P33689611A
73-23-01 Engine	01/13/77	Piston Pin Cracks From Grinding	11/22/06 at 4638.9 tt	PCW at overhaul			Rueben A Walkup A&P33689611A
75-08-09 Engine	08/18/77	Oil Pump Drive Shaft and Impeller	11/22/06 at 4638.9tt	PCW at overhaul			Rueben A Walkup A&P33689611A
75-09-15 Engine	04/30/75	Bendix Fuel Injector Flow Divider Cover Gasket		DNA by part number		n/a	Rueben A Walkup A&P33689611A
78-23-10 Engine	11/07/78	Bendix RSA Series Fuel Injector Bellows Seal		DNA by p/n		na	Rueben A Walkup A&P33689611A
79-04-05 Engine	09/26/79	Bendix RSA Series Fuel Injectors Diaphragm		DNA by p/n		n/a	Rueben A Walkup A&P33689611A
90-04-06 R1 Engine	05/28/91	Propeller Governor External Oil Line	11/22/06 at 4638.9 tt	PCW at overhaul		n/a	Rueben A Walkup A&P33689611A
92-12-05 Engine	07/10/92	Piston Pin Failure	11/22/06 at 4638.9 tt	PCW at overhaul		N/A	Rueben A Walkup A&P33689611A
93-11-11 Engine	06/21/93	Diaphragm Fuel Pumps Overhauled (by AAI) - Remove Affected Pump and Replace		DNA affected facility not used		N/A	Rueben A Walkup A&P33689611A
95-26-02 Engine	01/24/96	Detonation Due To Low Octane		DNA by N number is not listed in this AD		na	Rueben A Walkup A&P33689611A
96-09-10 Engine	07/15/96	Oil Pump Impeller Failure	11/22/06 at 4638.9 tt	PCW at overhaul		N/A	Rueben A Walkup A&P33689611A

96-23-03 12/17/96 Engine	High Pressure Fuel Pumps	11/22/06 at 4638.9 tt	PCW at overhaul		N/A	Rueben A Walkup A&P33689611A
97-15-11 08/12/97 Engine	Piston Pin Failure	11/22/06 at 4638.9 tt	PCW at overhaul		N/A	Rueben A Walkup A&P33689611A
98-02-08 03/30/98 Engine	Crankshaft Corrosion Pits		DNA Textron Lycoming 320 series limited to 160 horsepower, and 360 series, four cylinder reciprocating engines with fixed pitch propellers	Yes	n/a	Rueben A Walkup A&P33689611A
98-17-11 10/19/98 Engine	Crankshafts Installed by Nelson Balancing Service		DNA affected facility not used		N/A	Rueben A Walkup A&P33689611A
03-14-03 08/14/03 Engine	Rotary Fuel Pump Leaks		DNA by part number	Yes*	N/A	Rueben A Walkup A&P33689611A
04-10-14 06/25/04 Engine	Crankshaft Gear Retaining Bolt		not due no prop strike at this time	Yes		Rueben A Walkup A&P33689611A
09-02-03 02/09/09 Engine	RSA-5 or RSA-10 Series - Fuel Injection Servo Plug Gasket	10/23/2023 at 7528.3	CW by visual inspection, no leaks	Yes*	50 hours or next oil change	Alex VanderMey 3757160 <i>Alex VanderMey</i>
12-03-06 02/24/12 Engine	AVStar Fuel Servo Diaphragm		DNA part not installed		N/A	Rueben A Walkup A&P33689611A
12-19-01 10/24/12 Engine	Crankshaft Replacement		Does not apply by s/n listed in MSB596A		N/A	Rueben A Walkup A&P33689611A
15-19-07 11/03/15 Engine	Fuel Injector Fuel Lines and Clamps	10/23/2023 at 7528.3	CW By visual inspection	Yes	uncowling	Alex VanderMey 3757160 <i>Alex VanderMey</i>
17-16-11 08/15/17 Engine	Connecting Rod Failure		DNA by s/n listed in SB 632B		N/A	Rueben A Walkup A&P33689611A
22-16-03 08/15/22 Engine	S-1200 Series Magneto Roller Bearings		DNA by model #		na	Rueben A Walkup A&P33689611A

Propeller: Hartzell HC-C3Y Series

AD# Eff Date Category	Subject	Date/Hours at Compliance	Method of Compliance	Rec	Date/Hours Next Due	Signature and Number
94-17-13 09/15/94 Propeller	Propeller Hub Grease Fitting Hole Cracks		DNA by engine type, affected engines are utilizing Textron Lycoming T10-540 or LT10-540 series reciprocating engines	Yes	na	Rueben A Walkup A&P33689611A
01-07-03 06/04/01 Propeller	BASCO Serviced Propellers		DNA facility not used.		N/A	Rueben A Walkup A&P33689611A
03-13-17 07/18/03 Propeller	T and W Serviced Propellers		DNA facility not used.		N/A	Rueben A Walkup A&P33689611A
05-14-11 08/17/05 Propeller	Southern California Propeller Serviced Propellers		DNA facility not used.		N/A	Rueben A Walkup A&P33689611A

06-24-07 01/03/07 Propeller	Oxford Aviation/CSE Aviation Serviced Propellers		DNA facility not used.		N/A	Rueben A Walkup A&P33689611A
07-26-09 01/30/08 Propeller	Fatigue Cracks		DNA by date of MFG		NA	Rueben A Walkup A&P33689611A
08-13-28 07/17/08 Propeller	Hub Blade Socket Lubrication Hole Cracks		DNA by M# this is a right hand rotation engine	Yes*	NA	Rueben A Walkup A&P33689611A

Report Prepared By
Rueben A Walkup
33689611A
10/23/27